

## Vehicle Report

### Specification


No. <b>5103</b>	Make <b>MAZDA</b>	Vehicle <b>RX-7</b>	Model <b>E-FD3S</b>	Type/Door <b>2D</b>	Score <b>3</b>
	First Registration <b>1998 / 2</b> <sub>M</sub>	Displacement <b>RE</b> <sub>cc</sub>	Grade <b>TYPE RZ</b>	<b>2WD</b>	
					Interior Score <b>C</b>

Inspection Valid (Shaken)	<b>X</b>	<b>Y</b>	<b>X</b>	<b>M</b>	Shift Type <b>F5</b>
Mileage <b>150,108</b> km					AC Type <b>AC</b>
Body Color	Base Color <b>BLACK</b>	Color Change <b>→</b>	Color Code <b>PZ</b>	Interior Color <b>Black</b>	
Fuel	<b>Gasoline</b>		Passenger	Maintenance Book	<b>NO</b>
Recycling Deposit	<b>10,600</b> JPY		<b>2</b> Seater		

OEM PARTS	S	R	OEM AW	P	S	P	W
	Leather Seat		T	V	Navi		Airbag

### ◎ Specification

- NARDI Classic wood Steering Wheel
- Aftermarket Turbo Timer
- CARROZZERIA HDD NAVI
- ETC
- MAZDA Speed Muffler
- MAZDA Dual Down Pipe

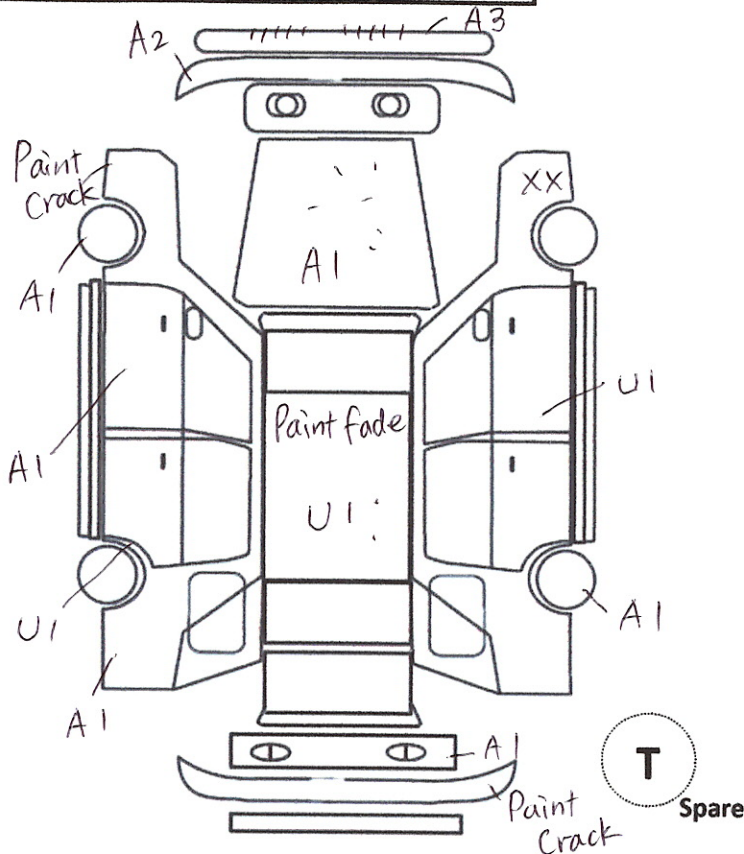

### ✓ Trust Kikaku Inspection Report

- Has scratches over all.
- AirBag Alert Lamp is ON.
- Has tear on driver seat.
- Has distortion on left baffle.
- Left front fender liner is missing.
- Engine Compression Result  
Front Side: 0.71/0.73/0.74  
Rear Side: 0.73/0.75/0.71

<b>A</b>	<b>Scar</b>	<b>S</b>	<b>Rust</b>
<b>U</b>	<b>Dent</b>	<b>C</b>	<b>Corrosion</b>
<b>B</b>	<b>Scratch &amp; Dent</b>	<b>G</b>	<b>Stone Chip</b>
<b>P</b>	<b>Repaint Required</b>	<b>X</b>	<b>Replacement Required</b>
<b>W</b>	<b>Repair Mark</b>	<b>XX</b>	<b>Replaced</b>

Engine	13B-REW
NA/TURBO	TURBO
Model No.	06937
Classification No.	0205

**DEFECT REPORT**

◎ Scar · Dent · Repir Part

◎ Electronic

• Has scratches and paint cracks on front bumper.	• Nothing in paticular.
• Has scratches on hood.	
• Has scratches on front lip spoiler.	
• Has scratches on roof.	
• Has scratches and paint cracks on rear bumper.	
• Has scratches on passenger's seat side door.	
• Driver's seat side door handle is not fit well.	
• Has gutter marks and rust on Aluminum wheel.	
• Has dent on driver's seat side door.	

**OTHER****RECOMMEND POINT**

• Has yellowing on indicator.	• Rare! 1998 model FD3S RX-7 Type RZ!
• Has cracks on right side A/C vent.	• RZ OEM RECARO bucket seat & BBS Wheels!
• Console box has cut on leather.	• Engine, exterior and suspension are fully normal!
• Driver's seat side door handle is not fit well, and it is shaky.	• Suspension is stable! No worn!
• Has coolant fluid leakage.	• Gear shifts smoothly and no abnormal sound!
• Has engine oil leakage.	• ETC, CARROZERIA HDD Navi are installed!
	• NARDI Classic Wood Steering Wheel!
	• MAZDA Speed Down Pipe & Muffler!